


# Triple Facial Tray WAGO Block Configuration for 12/24-Volt Buck/Boost Transformer

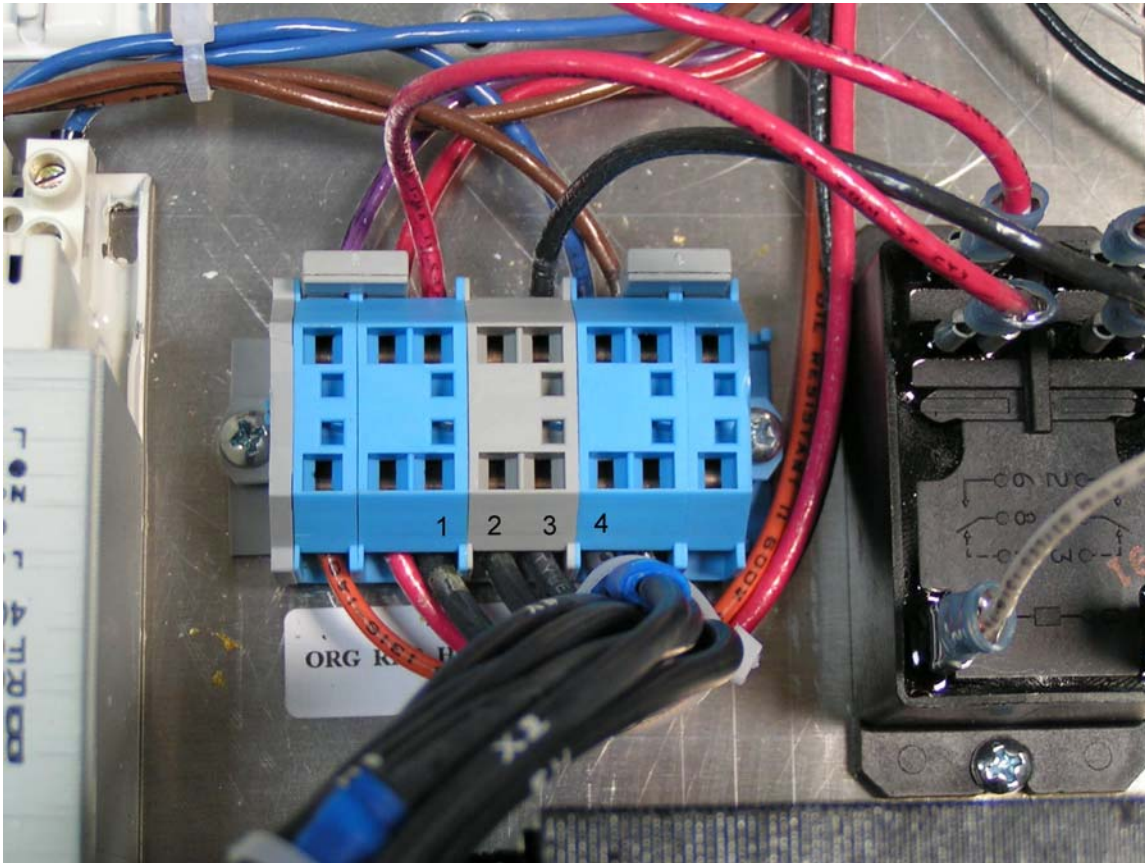

## 24-Volt Boost Configuration

Buck / Boost Transformer Wiring Configuration

Splice Leads H2 and H3 together with a wire nut or equivalent.

Splice Leads X2 and X3 together with a wire nut or equivalent..

## WAGO Block Configuration

Position Number	Transformer Lead ID
1	H1
2	H4
3	X1
4	X4

## 12-Volt Boost Wiring Configuration

Buck / Boost Transformer Wiring Configuration

Splice Leads H2 and H3 together with a wire nut or equivalent.

Splice Leads X1, X3, H4, and a 6-inch pigtail of BLK 14 GA Wire

### WAGO Block Configuration

Position Number	Transformer Lead ID
1	H1
2	NC
3	Pig Tail from X1, X3, H4 Splice
4	X2 & X4

## 12-Volt Buck Wiring Configuration

Buck / Boost Transformer Wiring Configuration

Splice Leads H2 and H3 together with a wire nut or equivalent.

Splice Leads X1, X3, H4, and a 6-inch pigtail of BLK 14 GA Wire

### WAGO Block Configuration

Position Number	Transformer Lead ID
1	H1
2	X2
3	X4
4	Pigtail from X1, X3, H4 splice

## 24-Volt Buck Wiring Configuration

Buck / Boost Transformer Wiring Configuration

Splice Leads H2 and H3 together with a wire nut or equivalent.

Splice Leads X2 and X3 together with a wire nut or equivalent.

### WAGO Block Configuration

Position Number	Transformer Lead ID
1	H1
2	X4
3	NC
4	X1 & X4